

Gegenstand : Pedalverstellseilzug
 Betroffen : Segelflugzeug LS7, alle Werknummern
 Dringlichkeit : vor dem nächsten Start
 Vorgang : In einem Fall verklemmte sich das Pedalverstellseil zwischen Rolle und Führung und blockierte die Pedalverstellung.
 Maßnahmen und Material : Kontrolle und gegebenenfalls Verringern des Spiels der Rollenföhrung entsprechend Arbeitsanleitung zu TM 6022 / TM 7003.

Gewicht und S.P.-Lagen : entfällt

Hinweise : Durchführung durch sachkundige Person.
 Kontrolle und Bescheinigung der Durchführung durch einen Prüfer Klasse 3 im Bordbuch sowie im TH-LTA-Durchführungsbeleg, Wartungshandbuch Blatt 14-1.

LBA-anerkannt :  *U. Hoff* **LTA 91-110**
 03. April 1991

SUBJECT : Pedal adjustment cable **LBA-AD 91-110**

EFFECTIVITY : Sailplane model LS7, all serial numbers

ACCOMPLISHMENT : Before next flight

REASON : In one case the cable jammed between cable guide and pulley and disabled adjustment

MATERIAL and INSTRUCTIONS : Check lateral play of pulley in guide according to working instruction for TB 6022 / TB 7003 and adjust, if necessary

WEIGHT AND BALANCE : not affected

REMARKS : Accomplishment by skilled personnel of operator.
 Inspection and certification of accomplishment by licensed inspector in logbook and on TB-AD-Accomplishment List, page 14-1 of Instructions for Continued Airworthiness (Maintenance Manual).

Erstellt: 14. Mär. 91 <i>Leucke</i>	Geprüft: 15. Mär. 1991 <i>Wapka</i>
-------------------------------------	-------------------------------------